

AMERICAN SPECIALTIES, INC.


441 Saw Mill River Road, Yonkers, NY 10701 (914) 476.9000 • (914) 476.0688 www.americanspecialties.com

 MODEL №:
 64696A-6

 ISSUED:
 JAN 2008

REVISED: 6 AUG 2021

SEMI-RECESSED AUTOMATIC ROLL PAPER TOWEL DISPENSER AND WASTE RECEPTACLE (Pg 1 of 2)

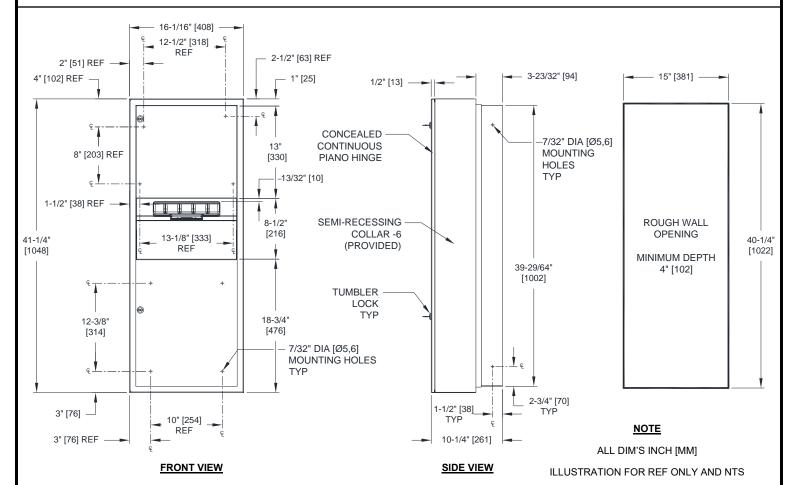

FOR CLEANING INSTRUCTIONS SEE APPROPIATE SECTIONS IN PRODUCT CARE & MAINTENANCE BULLETIN (PCM) ON ASI WEBSITE

SPECIFICATION

Semi-Recessed Automatic Roll Paper Towel Dispenser and Waste Receptacle shall hold and dispense 8" wide [203] x one 8" Dia. [Ø203] standard towel roll up to 800 ft. (244m) long and one 8" wide [203] stub roll up to 4" Dia. [Ø102] and shall have a waste capacity of 9.9 gallons (37.3 L). Automatic Touchless Roll Towel Dispenser shall be powered by four (4) D-size batteries (not supplied) and operate automatically to activate towel dispensing when hands are placed in sensor zone from 1/2" [13] below sensor to 4-1/2" [114] below sensor. At each activation unit shall feed out a length of towel selected by owner by setting length, delay and paper saver switches. Unit shall have an internal towel cut-off bar. Towel dispensing opening shall have a fully deburred edge for snag free dispensing and user safety. Full-face door, cabinet, dispenser and waste receptacle shall be type 304 stainless steel alloy 18-8. Cabinet shall be 20 gage with a 1" [25] wide perimeter trim to lay flush against SR-Collar face. Unit back plate for mechanism shall be 18 gage. All exposed surfaces shall have satin finish protected by PVC film easily removable after installation. Door shall be attached to the cabinet body with a full length 3/16" Dia. [Ø4,8] stainless steel multi-staked piano hinge and shall be held closed with two (2) tumbler locks keyed alike to other ASI washroom equipment. Waste container shall have hemmed edges for safety and a finger grip for easy removal. Structural assembly of all components shall be of welded construction.

Semi-Recessed Automatic Roll Paper Towel Dispenser and Waste Receptacle shall be Model № 64696A-6 as manufactured by American Specialties, Inc., 441 Saw Mill River Road, Yonkers, NY 10701-4913



AMERICAN SPECIALTIES, INC.

441 Saw Mill River Road, Yonkers, NY 10701 (914) 476.9000 • (914) 476.0688 www.americanspecialties.com

MODEL №:	64696A-6
ISSUED:	JAN 2008
REVISED:	6 AUG 2021

SEMI-RECESSED AUTOMATIC ROLL PAPER TOWEL DISPENSER AND WASTE RECEPTACLE (Pg 2 of 2)

INSTALLATION

Install unit in wall recess using № 10 self-threading pan head or flat head screws (by others) through concealed mounting holes provided. Note that top of Rough Wall Opening (RWO) is 1/2" [13] below top of unit. For compliance with ANSI A-117.1, 2015 ABA Standards and 2010 ADA Accessibility Standards install unit so that top edge of towel dispenser opening is 48" [1219] Maximum Above Finished Floor (Max AFF) only if clear floor reach access is provided. SR-Collar is slid onto cabinet back prior to installing in wall. For general utility install unit with top of towel dispenser opening between 49" [1245] and 56" [1422] AFF.

RWO required is 15" [381] W x 40-1/4" [1022] H x 4" [102] D Min

OPERATION

Towels are dispensed one at a time automatically when hands are placed in sensor zone until supply is depleted. Length of towel dispensed is predetermined by owner by making selections on three (3) three (3)-position switches for length, delay, economy. Unit may be reloaded with a full roll to automatically start when finished with an existing partial roll and will continue to feed properly when reloaded with a full roll and partial roll is transferred to stub roll position. Refill dispenser by unlocking door and replacing towel roll for an empty or partially empty unit. Locking full-face door over compartments prevents unauthorized access and roll and/or receptacle removal. Instructional label is provided inside cabinet for service replacement of roll towels and setting of length, dispense delay and economy switches. Dispenser supply is replenished, batteries are replaced and waste container is emptied manually on cycles determined by maintenance needs.

(704) 937-2673